

Date: Wednesday, 29/04/2009 8:36:34 AM
 User: Linda Lacelle

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services	Drawing Name : 212 X-TUBE ,LOW STANDARD FWD
Job Number : 47582	
Estimate Number : 13217	
P.O. Number :	Part Number : D212664107TRN
This Issue : 29/04/2009 S.O. No. :	Drawing Number : D212-664-147 REV A
Prsht Rev. : NC	Project Number : N/A
First Issue : / / Type : CROSSTUBES	Drawing Revision : A
Previous Run : 47581	Material :
Written By :	Due Date : 08/05/2009 Qty: 1 Um: Each
Checked & Approved By :	
Comment : Est Rev:A New Issue 08-03-06 DD Verified by:ec Est Rev B Removed polish 08.04.02 EC verified: DD	

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
----------------	------------------------------	----------------------

1.0	D6019128	Crosstube Material
-----	----------	--------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part number Description Batch

1 D6019-128 Crosstube 329369

Check OD = 2.750"; ID = 2.125"

****Keep and Identify off -cuts with part # and Batch for cuffs*****

Q.M. 09.04.30①

2.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
-----	------------	----------------------------

**Comment:** MORI SEIKI

1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA705

2-Turn first side as per Folio FA113

3-File down transition lines smooth.

Q.M. 09.04.30①

3.0	QC1	INSPECT ALL DIM TO DIM SHEET
-----	-----	------------------------------

**Comment:** INSPECT ALL DIM TO DIM SHEET

Q.M. 09.04.30①

4.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
-----	------------	----------------------------

**Comment:** MORI SEIKI CNC LATHE LARGE

1-Turn second side as per Folio FA705

2-File down transition lines smooth.

3- Remove plugs and sand

Q.M. 09.04.30①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 29/04/2009 8:36:34 AM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 212 X-TUBE ,LOW STANDARD FWD

Job Number: 47582

Part Number: D212664107TRN

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

QC1

INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

A.M 09.04.300

6.0

QC8

SECOND CHECK



Comment: SECOND CHECK

ANM 9-5-1

①

7.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

ANM 9-5-1

①

8.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

09-05-01

9.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Identify and stock in kanban rack

Location:

X-TUBE CELL

ANM 9-5-1

①

10.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

09/05/01

MF

Job Completion



MF
09-05-01

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD		Work Order: 47582
Description: Crosstube Assembly (205/212/412 Low Fwd)		Part Number: D212-664-147
Inspection Dwg: D212-664-147 Rev: A		Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article ☐ Prototype

Inspection Sheet	Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	0.313	+/-0.010	0.313	/			
	2.360	+0.005/-0.000	2.365	/			
	2.360	+0.005/-0.000	2.365	/			
	2.366	+0.005/-0.000	2.371	/			
	2.473	+0.005/-0.000	2.477	/			
	2.573	+0.005/-0.000	2.577	/			
	2.673	+0.005/-0.000	2.674	/			
	2.750	+0.005/-0.000	2.750	/			
	2.750	+0.005/-0.000	2.750	/			
SIDE B	0.313	+/-0.010	0.313	/			
	2.360	+0.005/-0.000	2.365	/			
	2.360	+0.005/-0.000	2.364	/			
	2.366	+0.005/-0.000	2.371	/			
	2.473	+0.005/-0.000	2.477	/			
	2.573	+0.005/-0.000	2.577	/			
	2.673	+0.005/-0.000	2.674	/			
	2.750	+0.005/-0.000	2.750	/			
	2.750	+0.005/-0.000	2.750	/			
	0.126.53	+/-0.020	126.550	/			

Measured by: Q.M.	Audited by: ANM	Prototype Approval: N/A
Date: 09.04.30	Date: 9-5-1	Date: N/A
Rev A	Date 08.11.07	Change New Issue (P/O D212-664-107)
Revised by KJ/EC	Approved [Signature]	


PARTS LIST:

Qty	Part Number	Description
X	D212-664-147	CROSSTUBE ASSEMBLY (205/212/412 LOW FWD)
1	D6019-128	CROSSTUBE
2	D2893-1	SUPPORT
4	D3595-063-450	RUBBER CUSHION
2	D3659-1	CUFF
4	MS21920-25	CLAMP (OR MS21920-26)
44	CR3212-4-06	RIVET (OR M7885/3-4-06)
A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTROM/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
A/R	SIKAFLEX-241/-291	SEALANT (OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6019-128
FINISHED LENGTH = 126.53±0.020 (BEFORE BENDING/TRIMMING)
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) ALL DIMENSIONS ARE IN INCHES
- 5) PART IS SYMMETRIC ABOUT CENTERLINE.
- 6) WHEN MACHINING TAPER, RUN-OFF PART AT STOCK. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 7) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D., EXCEPT UP TO 10% IS ALLOWED IN AREA NOTED.
- 8) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 9) SCRIBE DART PART NUMBER AND BATCH NUMBER ON INNER SURFACE OF TUBE WITH A VIBRATING STYLUS.
- 10) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 11) APPLY A 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2893-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 12) INSTALL MS21920-25 CLAMPS (OR -26) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE D2893-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE CROSSTUBE SUPPORT.
- 13) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.
- 14) INSTALL D3659-1 CUFF AFTER CHEMICAL CONVERSION COAT BUT BEFORE PAINT, WITH A LAYER OF SIKAFLEX-241/-291 OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT BETWEEN CUFF AND CROSSTUBE. SEAL EDGE OF CUFF TO ENSURE NO GAPS.
- 15) TOUCH-UP HOLES WITH CHEMICAL CONVERSION COAT.

RELEASED
07 79.24

A		07.07.07	NEW ISSUE
DESIGN	97	DRAWN BY	97
COPYRIGHT © 2007 BY DART AEROSPACE LTD.		 DART AEROSPACE LTD. <small>MARKESBURY, ONTARIO, CANADA</small>	
CHECKED	97	APPROVED	97
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		DRAWING NO.	REV. A
DATE	07.07.07	D212-664-147	SHEET 1 OF 3
		TITLE	SCALE
		CROSSTUBE (205/212/412 LOW FWD) NTS	




W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

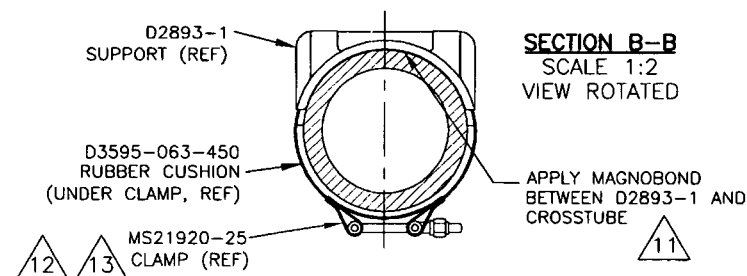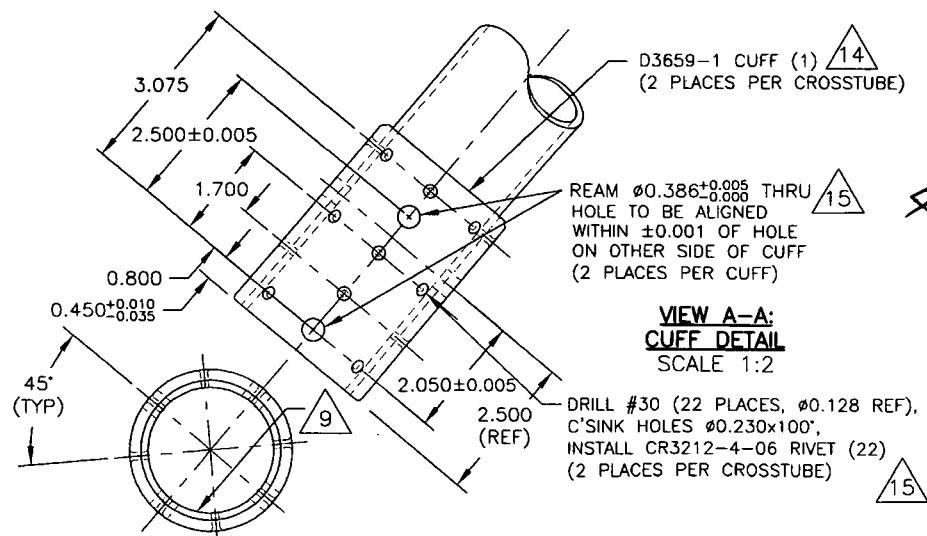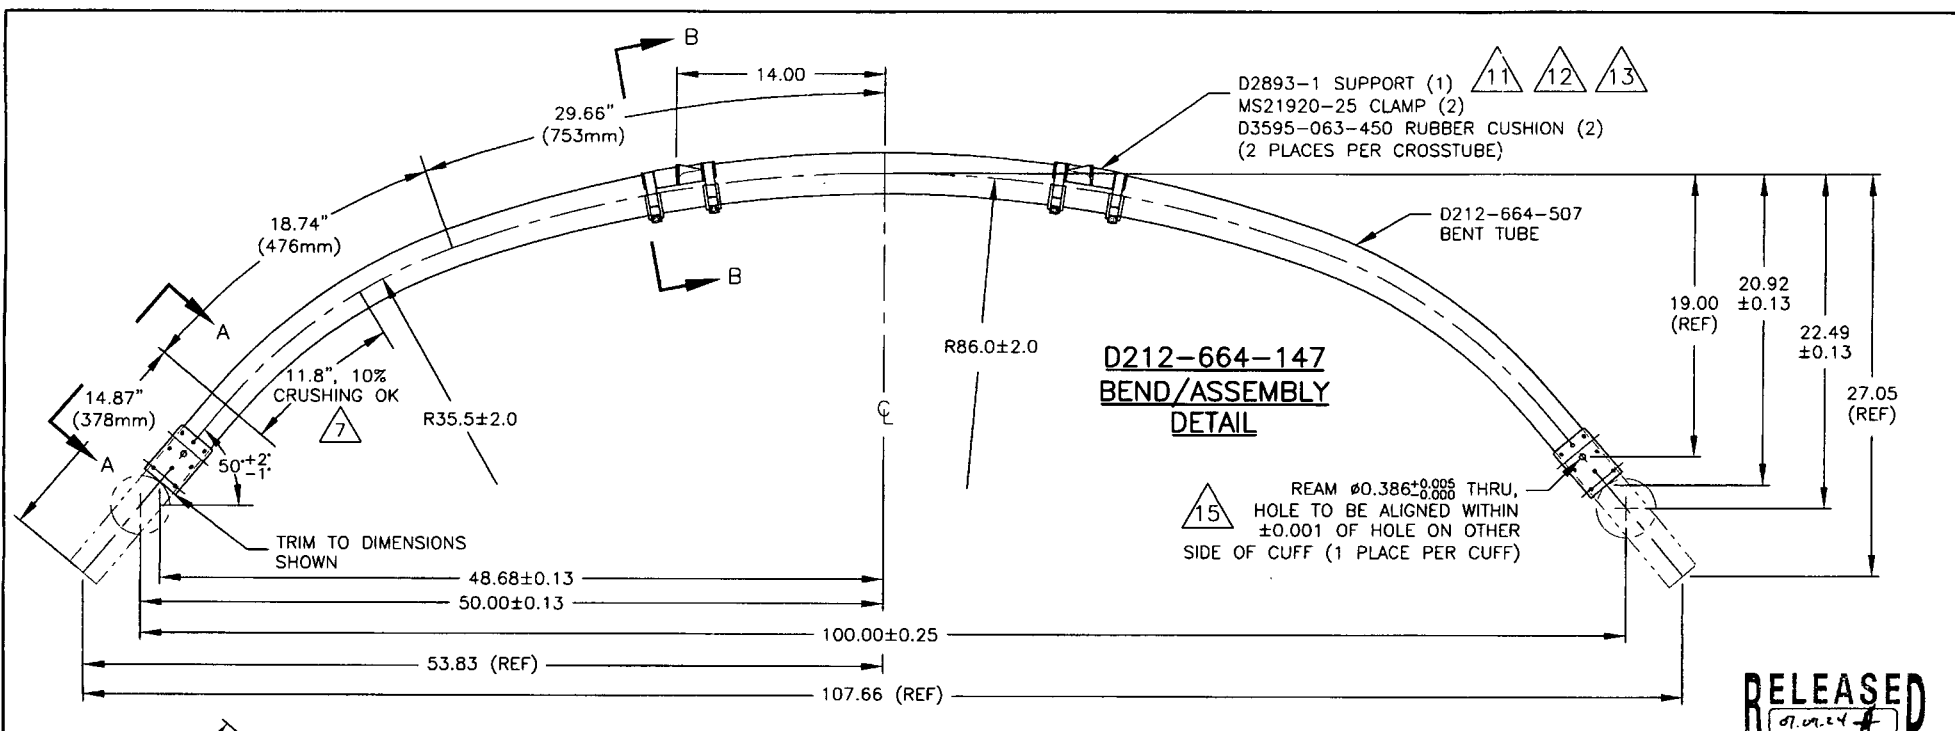

COPYRIGHT © 2007 BY DART AEROSPACE LTD.		DESIGN <i>qp</i>	DRAWN BY <i>qp</i>	DART	DART AEROSPACE LTD. WILKESBURY, ONTARIO, CANADA
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		CHECKED <i>qp</i>	APPROVED <i>qp</i>	DRAWING NO. D212-664-147	REV. A SHEET 2 OF 3
DATE 07.07.07		TITLE CROSSTUBE (205/212/412 LOW FWD)		SCALE 1:8	


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

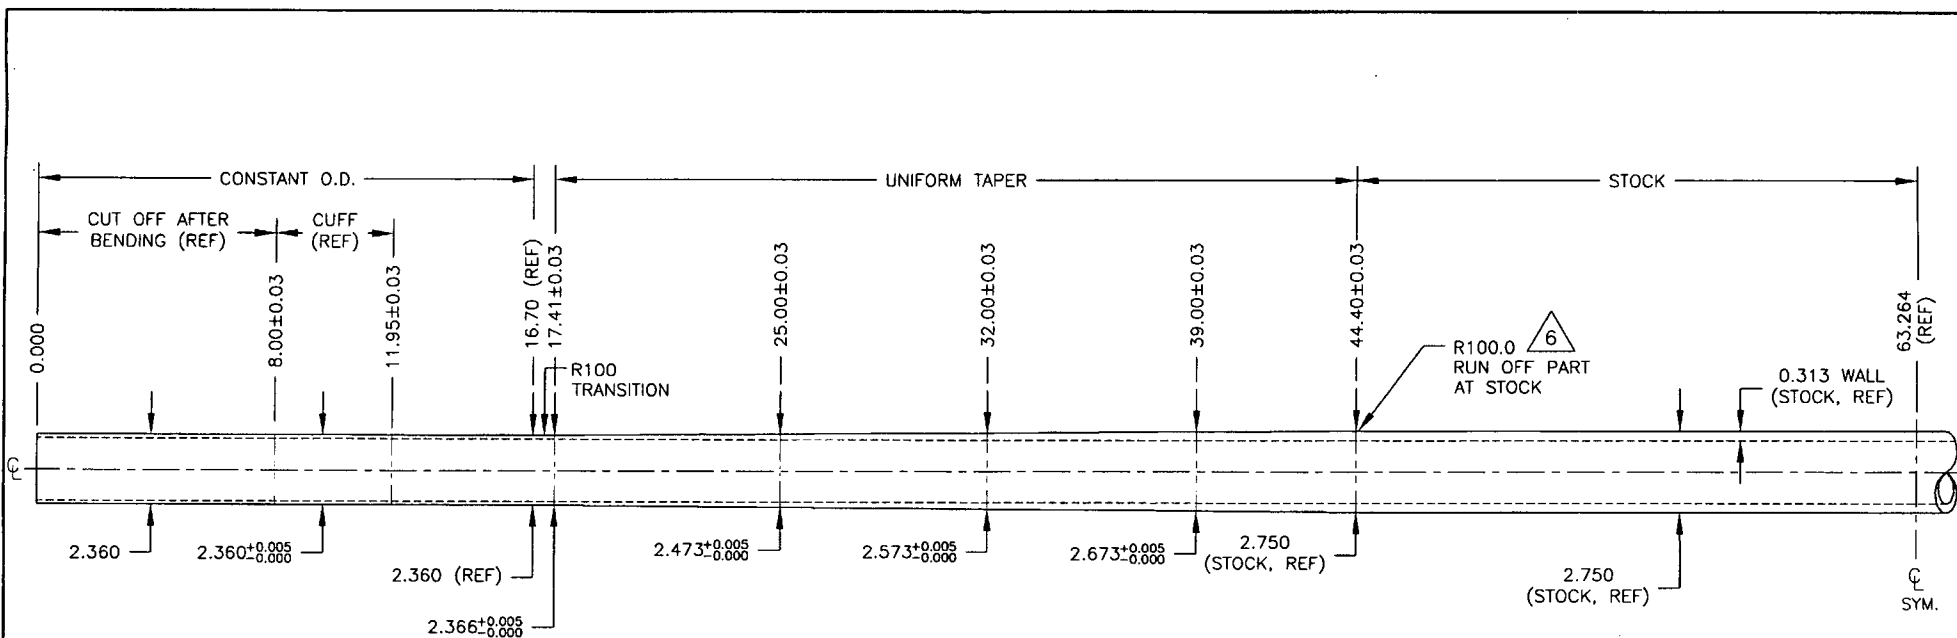

D212-664-147 MACHINING DETAIL

RELEASED
07.07.24

47582

COPYRIGHT © 2007 BY DART AEROSPACE LTD.		DESIGN <i>qp</i>	DRAWN BY <i>qp</i>	DART DART AEROSPACE LTD. HAMMERSBURY, ONTARIO, CANADA
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		CHECKED <i>qp</i>	APPROVED <i>qp</i>	DRAWING NO. D212-664-147 REV. A SHEET 3 OF 3
DATE 07.07.07		TITLE CROSSTUBE (205/212/412 LOW FWD) 1:4		

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries